SHUMFI!

SHUMMI!

SHUMPY!

SHUMP!

SHUMP!

SH

SHUMP!

SHUMFI!



095030-1843 Injector Valve Stem G2 Series Technical File SKU1: G1F10950301843



SHUMFITT

SHUMFIT

SHUMFIT

SHUMFIT

TIMM

SHUMFITT

SHUMFITT

SHUMFITT

SHUMFIT

TIFINE

SHUMFIT

SHUMFITT

SHUMFITT

SHUMFITT

TTimes

SHUMFIT

SHUMFITT

SHUMFITT

SHUMFITT

Triame

SHUMFIT

SHUMFITT

SHUMFITT

SHUMFITT

SHUMFIT

SHUMFIT

SHUMFITT

SHUMFITT

SH

SHE

SHR

SH

SHE

Tel: +8675523215133 SHUMFIT SHUMFITT Mob/Whatsapp: +86 13410541523

SHUMFITT

UMFITT

MATT

mail

-... ישטי בליטט 23215133 Website : <u>www.shumatt.com</u> Email: ruby@shumatt.com © 2024 Shenzhen Shumatt Technology Co., Ltd



095030-1843 Injector Valve Stem G2 Series Technical File

Content

| 1. 095030-1843 Injector Valve Stem Introduction | |
|--|----|
| 1.1. 095030-1843 Injector Valve Stem Basic Information | 2 |
| 1.2. 095030-1843Injector Valve Stem Common Part Number | 2 |
| 1.3. 095030-1843 Injector Valve Stem Parameter | 2 |
| 1.4. 095030-1843 Injector Valve Stem Specifications and Dimensions | 2 |
| 1.5. 095030-1843 Injector Valve Stem Quality Control | 2 |
| 1.6. 095030-1843 Injector Valve Stem Customized Service | 3 |
| 1.7. 095030-1843 Injector Valve Stem Package List&Size | 3 |
| 1.8. 095030-1843Injector Valve Stem Testing Standard and Certificate | 5 |
| 1.9. 095030-1843Injector Valve Stem Warranty Description | 5 |
| 2. 095030-1843 Injector Valve Stem Technical Support | 6 |
| 2.1. 095030-1843 Injector Valve Stem Measuring Tools | |
| 2.2. 095030-1843 Injector Valve Stem Measuring Steps | |
| 2.3. 095030-1843 Injector Valve Stem Installation Precautions | 7 |
| 2.4. Reasons For 095030-1843 Injector Valve Stem Not Working Normally | 8 |
| 2.5. Causes of 095030-1843 Injector Valve Stem Being Damaged | |
| 2.6. 095030-1843 Injector Valve Stem Storage Standard | |
| 2.7. 095030-1843 Injector Valve Stem Technical Support Obtaining Methods | 9 |
| 3. 095030-1843 Injector Valve Stem Purchase and Delivery | |
| 3.1. 095030-1843 Injector Valve Stem Purchase Payment Term | 10 |
| 3.2. 095030-1843 Injector Valve Stem Main Sales Markets | 10 |
| 3.3. 095030-1843 Injector Valve Stem Declaration Requirements | 10 |
| 3.4. 095030-1843 Injector Valve Stem Shipping Ways | |
| 3.5. 095030-1843 Injector Valve Stem Lead time | 10 |
| 3.6. 095030-1843 Injector Valve Stem Logistics Time for Destination Out of China's Areas | |
| 3.7. 095030-1843 Injector Valve Stem Packing | |
| 4. Company Information | 12 |
| 4.1. Company Introduction | |
| 4.2. Sale-men Contact Information | 13 |
| 5 Conveight Statement | 12 |

Mob/Whatsapp: +86 13410541523 Tel: +8675523215133

Email: ruby@shumatt.com

© 2024 Shenzhen Shumatt Technology Co., Ltd

Website: www.shumatt.com



095030-1843 Injector Valve Stem G2 Series Technical File

1. 095030-1843 Injector Valve Stem Introduction

1.1. 095030-1843 Injector Valve Stem Basic Information

| Title | 095030-1843 Injector Valve Stem China Made New |
|-------|--|
| SKU1 | G1F10950301843 |

1.2. 095030-1843Injector Valve Stem Common Part Number

(1) Injector Valve Stem Applicable Injector Model

| Injector Valve Stem Part Number | OE Number |
|---------------------------------|--------------|
| 095000-508# | 8-97313861-2 |

(2) Injector Valve Stem Matching Information

| Vehicle Brand | Car Model | Engine Model | Production Date |
|---------------|------------|--------------|-----------------|
| KOMATSU | INDUSTRIAL | P140 | 0010 |

(3) Injector Valve Stem Part Number Common Writing

095000-5080, 095000-5081, 095000-5082, 095000-5083, 095000-5084, 095000-5085, 095000-5086, 095000-5087, 095000-5088, 095000-5089, 095000-508#, 8-97313861-#, 095030-1843

1.3. 095030-1843 Injector Valve Stem Parameter

Adaptation System: Common Rail System Injector Valve Stem Series: G2 Series

Injector Valve Stem Size: L118mm* 4.3mm

1.4. 095030-1843 Injector Valve Stem Specifications and Dimensions

Injector Valve StemSize: 14*1*1=25 cm³ (L*W*H=V)

Single Injector Valve Stem Weight: 20g

Injector Valve Stem Weight With Packaging: 25g
Injector Valve Stem Quality: China Made New

Injector Valve Stem Package Size: 14* 1cm *1m =143 (L*W*H=V)

Injector Valve StemType: High Pressure Common Rail Injector Valve Stem

Injector Valve Stem MOQ: 1pcs

1.5. 095030-1843 Injector Valve Stem Quality Control

(1) Injector Valve Stem Testing

All parts of the Injector valve stem have undergone electrical characteristics testing, precision testing, high temperature testing, low temperature testing, withstand pressure testing, leakage testing, durability testing, and various working conditions testing.

(2) Injector Valve Stem Installation

The injector valve stem production and installation process is quality controlled. Our company strictly

Mob/Whatsapp: +86 13410541523 Tel: +8675523215133

Email: ruby@shumatt.com Website: www.shumatt.com

follows the standard product installation data and product installation steps for installation, such as injector stroke test, injector solenoid valve tightening torque, injector nozzle tightening torque.

(3) Injector Valve Stem Inspection

The factory inspection of the injector valve stem has undergone three inspections: full inspection, random inspection, and batch inspection. Different brands of test benches are used to test the same injector valve stem for more than three times for factory inspection, and the injector valve stem installation testing environment are progressed in dust-free workshop.

1.6. 095030-1843 Injector Valve Stem Customized Service

(1) Injector Valve Stem Customized Service Coverage: Meet OEM manufacturers' customization needs for shell engraving, logo engraving, injector valve stem internal packaging, injector valve stem external packaging and labels, etc.

| <u> </u> | | | | |
|------------|-------------------------------|-----------------------------------|--|--|
| No. | 1 | 2 | | |
| Image | Jane Jane | SHAME SHAME | | |
| AJMFTT TAJ | IFTT IIIIIIII | Training to him to him to | | |
| Name | Injector Valve Stem Engraving | Injector Valve Stem Packing&Label | | |

(2) Injector Valve Stem Customized Service Requirements:

The purchase of customized injector valve stem is no less than 10 pieces.

The purchase of customized injector valve stem boxes is no less than 1000 pieces.

⚠ When the customized products involve the need of specify logo, the OEM manufacturer is asked to provide trademark authorization and the sample of logo image file.

• Once the customized injector valve stem is sold, it can't be returned or exchanged if there is no quality problems.

1.7. 095030-1843 Injector Valve Stem Package List&Size

(1) Injector Valve Stem Spare Parts List

| | (=),cete. | raite eterriopare raite and | | |
|----|--------------------|-----------------------------|----------------------------|------------------------------|
| S | No. | 1 | 2 | 3 |
| 20 | Reference Image | ATT SH | MATT SHOW | THU SHUT |
| 9 | Name | Injector Valve Stem | Injector Valve Stem Length | Injector Valve Stem diameter |
| 1 | Description | Shr Shr | L118.77mm | Φ 4.3 mm |

▲ Minors are forbidden to use the injector assembly, O-ring, nozzle protective cover, injector house protective cover, oil return protective cover, VCI anti-rust bag, and air bubble bag to avoid personal injury.

▲ O-ring and washer shim are disposable installation accessories, and need to be replaced for

Mob/Whatsapp: +86 13410541523 Tel: +8675523215133

Email: ruby@shumatt.com Website: www.shumatt.com

re-installation.

▲ The nozzle protective cover, the injector house protective cover, and the oil return protective cover are recyclable accessories that can be reused.

▲ VCI anti-rust bags and bubble bags are non-degradable materials. Please dispose of them properly after using.

▲ The injector and the installation parts should be coated with appropriate sealing oil during installation.

(2) Injector Valve Stem Package Size



Pic No.1

| 10. | No. | Name | Injector Valve Stem Package Size (cm) |
|-----|-----|-----------------------------|---------------------------------------|
| | 1 | Injector Valve Stem Package | 14*1*1 |

Mob/Whatsapp: +86 13410541523 Tel: +8675523215133

Email: ruby@shumatt.com Website: www.shumatt.com

1.8. 095030-1843Injector Valve Stem Testing Standard and Certificate

We can provide the factory quality inspection test report of each injector valve stem to ensure that each injector valve stem delivered meets the engine performance indicators.



Pic No.2

1.9. 095030-1843Injector Valve Stem Warranty Description

(1) Product Warranty Conditions and Instructions

It is necessary to provide pictures, videos, or test reports detected by the injector valve stem inspection equipment as evidence to feed back to the salesman when the injector valve stem is abnormal during using.

Abnormal conditions are properly explained such as: 1.Smoke, 2. Engine shake, 3. Difficulty starting the engine, 4. Engine noise, 5. Oil leakage etc.

(2) Injector Valve Stem Warranty Coverage

Within 15 days after customer receives the 095030-1843 injector valve stem, if there is a performance failure and the product has no appearance damage, customer can choose to replace it or repair it;

If the 095030-1843 injector valve stem has performance problems during the warranty period (6-12 months), and it is confirmed that it is product's problems after testing, you can contact our salesmen to replace the same model or a reworked product with the same performance for free;

If the injector valve stem has obvious scratches, it can only be repaired and it will be returned as it is if the product is confirmed to be fault-free.

▲ Tips: For products not covered by warranty, our company can provide paid maintenance services. For

Mob/Whatsapp: +86 13410541523 Tel: +8675523215133

Email: ruby@shumatt.com Website: www.shumatt.com


products after paid repaired, the same performance problem will have a free warranty period within 3 months from the date of repairing.

(3) injector valve stem Out of Warranty Coverage

- The warranty period has expired.
- Injector valve stem failure caused by high temperature, high pressure, humidity, rain and snow, saline-alkali land, earthquake, and used in abnormal environment.
- Customer disassembles or repairs the injector valve stem personally resulting in damage to the injector valve stem.
- Injector valve stem damage caused by man-made reasons (throwing, strong magnetic field magnetization, set fire).
- ⑤ Injector valve stem failure or injector valve stem damage caused by non-injector valve stem design, technology, manufacturing, quality and other issues.
 - 6 Injector valve stem failure due to system pressure exceeding system approved pressure.
 - Injector valve stem failure caused by system voltage exceeding approved voltage.
- Injector valve stem failure caused by impurities (water, lead, aluminum powder, iron powder, sulfide) in the system fuel exceeding the standard requirements.
- Injector valve stem failure caused by not installing according to the tightening torque specified in the vehicle engine maintenance manual (the tightening torque is too large or too small).
- Injector valve stem failure caused by not following the installation angle specified in the vehicle engine maintenance manual.
- 11 Injector valve stem failure caused by not following the cleaning requirements specified in the vehicle engine maintenance manual.
- 12 Injector valve stem failure caused by failure to replace consumable parts as specified in the vehicle engine maintenance manual.
- 13 Injector valve stem failure caused by not complying with the intake system fit clearance and exhaust system fit clearance requirements specified in the vehicle engine maintenance manual.
- 14 Failure to replace the consumable parts and the fitting clearance of the oil inlet system pipeline and the injector valve stem connection in accordance with the fuel intake system specified in the vehicle engine maintenance manual.

2. 095030-1843 Injector Valve Stem Technical Support

2.1. 095030-1843 Injector Valve Stem Measuring Tools

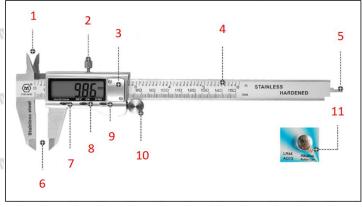

Mob/Whatsapp: +86 13410541523 Tel: +8675523215133 Email: ruby@shumatt.com

© 2024 Shenzhen Shumatt Technology Co., Ltd

Website: www.shumatt.com



| 1. Inner diameter measuring claw | 7. inch/mm metric and inch conversion button |
|----------------------------------|--|
| 2. Limit screw | 8. OFF/ON power button |
| 3. Battery installation place | 9. ZERO button |
| 4. Ruler body | 10. Push roller |
| 5. depth measurement | 11. Button battery |
| 6. depth measurement | |

2.2. 095030-1843 Injector Valve Stem Measuring Steps



2.3. 095030-1843 Injector Valve Stem Installation Precautions

- (1) The replacement of the injector valve stem must strictly follow the electrical system, the approved pressure of the low-pressure fuel intake system, the approved pressure of the high-pressure fuel circuit system, and fuel system replacement consumables requirements (including the low-pressure fuel circuit system filter and the high-pressure fuel circuit) specified in the vehicle engine maintenance manual.
- Replacement of wearing parts of the fuel system, cleaning requirements for the connection between the fuel system and the injector valve stem, the fitting clearance of the injector valve stem connection, the installation angle and tightening torque of the injector valve stem, the fitting clearance of the intake system, and the fitting clearance of the exhaust system to ensure the service life of the engine and the normal operation of the injector valve stem.
- (3) When installing the injector valve stem on the engine, it is necessary to clean the engine block, cylinder head and other parts connected to the injector valve stem, and ensure that there is no dust, carbon deposits, water, rust spots, etc.
- (4) Before installing, check whether the injector valve stem nozzle gasket has been replaced and installed on the injector valve stem.
- (5) When installing the injector valve stem, apply lubricant between the injector valve stem, fuel nozzle sealing gasket and O-ring.
- Failure to replace the gasket with a new one may result in: deformation of the tight cap of nozzle, deformation of nozzle, deformation of nozzle orifice, oil leakage and air leakage, which will cause serious damage to the injector valve stem and nozzle to break and cause damage to the engine.

Tel: +8675523215133 Mob/Whatsapp: +86 13410541523 Email: ruby@shumatt.com Website: www.shumatt.com



- (7) When installing the injector valve stem on the engine, please carefully check the components related to the installation of the injector valve stem, such as the injector valve stem pressure plate, screw, injector valve stem rod and other accessories are not deformed, and install it in strict accordance with the operation steps of the engine maintenance manual.
- (8) It is forbidden to operate the bare injector valve stem for a long time in an environment with serious dust pollution and corrosion to iron products.
- (9) It is forbidden to operate the bare injector valve stem for a long time in a strong magnetic field environment.

2.4. Reasons For 095030-1843 Injector Valve Stem Not Working Normally

- (1) There is air in the oil circuit of the engine fuel system.
- (2) Vehicle oil pump oil supply system is not normal.
- (3) Engine common rail system oil leakage or pressure limiting valve is damaged.
- (4) There is a short circuit, cutting out and poor contact in the wiring harness connected to the injector valve stem of the vehicle.
- (5) The long-term placement of the injector valve stem causes the anti-rust oil to solidify, and the internal components are stuck or the oil holes are blocked.
- ▲ Before installing, carefully check whether other components in the common rail system except the injector valve stem are damaged so as to prevent the injector valve stem from not working properly after being replaced.

2.5. Causes of 095030-1843 Injector Valve Stem Being Damaged

- (1) Failure to operate correctly according to the engine maintenance manual during disassembly and assembly resulted in damage to the injector valve stem.
- (2) The fuel used for the vehicle does not meet the standard, causing damage to the injector valve stem, such as: the water content in the fuel oil exceeds the standard, iron powder, aluminum powder, sulfide impurities exceed the standard, etc.
- (3) The engine is not regularly maintained according to the engine maintenance manual (please refer to the vehicle maintenance manual for the maintenance mileage). For example, failure to replace the lubricating oil of the engine system for a long time will cause abnormal wear of the engine, excessive exhaust gas volume or a large amount of carbon deposits inside the engine. The filter is not replaced during maintenance or the replaced filter cannot reach the original filter standard. All above reasons can cause damage to the injector valve stem.
- (4) The abrasion of the oil pump produces iron powder and aluminum powder enter the injector valve stem and cause damage to the injector valve stem.
- (5) The deformation and abrasion of fuel tank result in iron powder or aluminum powder entering the injector valve stem and causing damage to the injector valve stem.
- (6) The injector valve stem is damaged due to replacement or adjustment of the relevant parts of the injector valve stem. For example, the valve clearance does not meet the standard after the engine is repaired, the replacement or modification of the wiring harness connected to the injector valve stem fails to meet the original standard.
- (7) The engine is overheated and overloaded for a long time working results in damage to the injector valve stem.

Mob/Whatsapp: +86 13410541523 Tel: +8675523215133

Email: <u>ruby@shumatt.com</u> Website: <u>www.shumatt.com</u>



- (8) The injector valve stem will be damaged naturally at the end of its working life.
- (9) The injector valve stem is magnetized (injector valve stem parts' magnetic exceeded) causing the injector valve stem to not work properly.
- A Before replacing the injector valve stem, please check the engine parts carefully according to the engine maintenance manual to avoid the injector valve stem being damaged again after replacement.

2.6. 095030-1843 Injector Valve Stem Storage Standard

(1) Choose a Suitable Storage Place

The warehouse and cargo yard where the injector valve stems are stored should be kept clean and dry, and away from the factory buildings that generate harmful gases and dust; do not mix with acid, alkali, salt and other substances; the storage place should have a good drainage system; the cargo yard should be flattened with gravel or furnace ash etc. to enhance the water permeability of the surface layer to keep the reservoir area dry.

(2) Strict Requirements of Warehousing

Strict inspections should be carried out when the injector valve stems are put into storage, the surface cleaning work should be done well to remove water traces, oil stains, ash and other dirt, remove the rust and do anti-rust treatment in time. Packaged injector valve stems must be protected from damage.

(3) Keep The Warehouse Dry And Preventing Moisture

The relative humidity is usually below 70% for the injector valve stems placed in the room, and the corrosion of the injector valve stems is significantly reduced.

Injector valve stems must be stored in the warehouse, and they are forbidden to store in the same warehouse with commodities with high water content.

(4) Stack Properly

After the injector valve stem is exposed to rain, the corrosion rate will increase significantly. The purpose of sealing is to isolate the injector valve stem from rainwater and humid air, so the warehouse window should be checked in time to avoid rainwater entering the warehouse

If the injector valve stem package is damaged, it should be repaired or replaced; when the package is damp, the packaging material should be dried; if the original anti-corrosion and oil applied at the factory is found to be damaged or dried up, it should be cleaned and re-applied oil in time.

▲ It is forbidden to leave the injector valve stem exposed in the air for a long time.

▲ It is forbidden to store acid, alkali, salt and other substances together with the injector valve stem.

▲ The unpacked injector valve stem must be rust-proof during secondary storage.

2.7. 095030-1843 Injector Valve Stem Technical Support Obtaining Methods

- (1) Injector Valve Stem Technical File, visit http://shumatt.com to get the technical file.
- (2) Injector Valve Stem Technical Videos

Facebook: Visit https://www.facebook.com/hison.li to get the technical videos, constantly follow can get more information.

YouTube: https://www.youtube.com/channel/UCByvYBx7VjV mAfxh Hu-aw to get the technical videos, constantly follow can get more information.

Shumatt: Visit http://shumatt.com to get the technical videos.

(3) Injector Valve Stem Information Query Software

Mob/Whatsapp: +86 13410541523 Tel: +8675523215133

Email: ruby@shumatt.com Website: www.shumatt.com

TruckBook Parts EPC APP, Android/Apple App Store download and install, visit http://shumatt.com to get the download and installation tutorial.

(4) Search the injector valve stem test data through TruckBook Parts EPC APP.

3. 095030-1843 Injector Valve Stem Purchase and Delivery

3.1. 095030-1843 Injector Valve Stem Purchase Payment Term

Payment Terms: T/T, PayPal, Alipay, WeChat

▲ Please contact our salesmen for specific payment information.

3.2. 095030-1843 Injector Valve Stem Main Sales Markets

Injector Valve Stem Main Sales Markets: Asia, Europe, North America, South America, Africa etc.

3.3. 095030-1843 Injector Valve Stem Declaration Requirements

Shumatt can assist customers to provide the following documents for import customs clearance: contract, invoice, packing list, bill of lading, insurance policy, certificate of origin, etc.

3.4. 095030-1843 Injector Valve Stem Shipping Ways

Destination in China Areas: SF Express, Debon Express, the corresponding logistics company can be provided according to customer requirements in special cases.

Destinations Out of China's Areas: DHL, UPS, FedEx, TNT air, ocean or other shipping methods required by customers.

3.5. **095030-1843** Injector Valve Stem Lead time

Lead time: Send out within 3-7 working days after receiving payment (Except for special products and special cases).

3.6. 095030-1843 Injector Valve Stem Logistics Time for Destination Out of China's Areas

DHL Logistics Time:

| Country or Region of Departure | 3 3, | | Australia and New Zealand | Europe | America | Other Countries |
|-----------------------------------|--------|--------|------------------------------|--------|--------------|--------------------|
| China's Mainland | 7 Days | 7 Days | 8 Days | 8 Days | 8-12 Days | 7-10 Days |

UPS Logistics Time: Country or Region of Departure: China's Mainland

| Country of Destination | Estimated Arrival Time | Country of Destination | Estimated Arrival Time | Country of Destination | Estimated Arrival Time |
|---------------------------|------------------------|------------------------|---------------------------|------------------------|---------------------------|
| Japan | 3 Days | UK | 5-7Days | Egypt | 5-7 Days |
| Turkey | 5-7 Days | Singapore | 3 Days | Switzerland | 5-7 Days |
| Bahrain | 5-7 Days | Latvia | 7-10 Days | New Zealand | 7-10 Days |
| Sri Lanka | 5-7 Days | Thailand | 3 Days | Austria | 5-7 Days |
| Romania | 5-7 Days | Vietnam | 3-5 Days | Estonia | 5-7 Days |
| Malaysia | 3-5 Days | Israel | 5-7 Days | Mexico | 7-10 Days |
| France | 5-7 Days | America | 5-7 Days | United Arab Emirates | 5-7 Days |
| Italy | 5-7 Days | Netherlands | 5-7 Days | Bengal | 7-10 Days |
| Lebanon | 5-7 Days | Philippine | 3-5 Days | Greece | 7-10 Days |

Mob/Whatsapp: +86 13410541523 Tel: +8675523215133

Email: ruby@shumatt.com Website: www.shumatt.co

| South Korea | 3 Days | Spain | 5-7 Days | Myanmar | 5-7 Days |
|-------------|-----------|-------------------|-------------|--------------|-----------|
| Canada | 5-7 Days | Germany | 5-7 Days | Saudi Arabia | 7-10 Days |
| Portugal | 5-7 Days | Australia | 5-7 Days | South Africa | 7-10 Days |
| Denmark | 5-7 Days | Belgium | 5-7 Days | Ukraine | 7-10 Days |
| India | 7-10 Days | Qatar | 7-10 Days | Poland | 5-7 Days |
| Indonesia | 3-5 Days | Morocco | 7-10 Days | Pakistan | 7-10 Days |
| Kuwait | 7-10 Days | Stilling Stilling | SHOW / SHOW | SHOW SHOW | SHOW |

The logistics time is for reference only, subjects are according to the actual arrival.

3.7. 095030-1843 Injector Valve Stem Packing

Domestic Express Packaging: Usually wrapped in waterproof scotch tape, such as picture No.4.

International Express Packaging: Wrapped with waterproof yellow tape after wrapping the black protective film, such as picture No. 5.

Pallet Shipping: Use fumigation free and recycling trays that meet export requirements, and use white wrapping protective film to wrap and bind with cable ties for the outside, such as picture No. 6, also, the products can be packaged according to customers' requirements.

The packing tray is made of plastic and can be recycled.

Transparent tape, yellow tape, black wrapping protective film, white wrapping protective film are non-degradable materials, please dispose of them properly.

▲ Minors are prohibited from using transparent tape, yellow tape, black wrapping protective film, and white wrapping protective film to avoid personal injury.



Pic No. 4 **Domestic Express Packaging:** Wrapped with transparent tape



Pic No. 5 **International Express Packaging:** Wrapped with yellow tape after wrapping black protective film

Website: www.shumatt.com

Mob/Whatsapp: +86 13410541523 Tel: +8675523215133 Email: ruby@shumatt.com

© 2024 Shenzhen Shumatt Technology Co., Ltd

11 / 15





Pic No. 6

Pallet Shipping: Use pallet that meet export requirements, and use white wrapping protective film to wrap and bind with cable ties

4. Company Information



Pic No. 7

4.1. Company Introduction

Chinese Name: 深圳市舒马特科技有限公司

English Name: Shenzhen Shumatt Technology Co., Ltd

Injector Valve Stem Manufacturer: Shenzhen Shumatt Technology Co., Ltd

☐ Mob Phone/WeChat: +86-13410541523

HK Telephone: +852-67653519

UMFIT.

Mob/Whatsapp: +86 13410541523 Tel: +8675523215133

Email: ruby@shumatt.com Website: www.shumatt.com



Telephone: +86-755-23215133

Email: ruby@shumatt.com

Website: www.shumatt.com

Shenzhen Office: 11-12, Floor 14, Building 13, Qinchengda Building, Exit A, Honglang North Subway Station, Bao'an District, Shenzhen, China Mainland

Shenzhen Office: Exit C, Qiao Touxi Metro Station, No. 66 Chongqing Road, Fuhai Avenue, Bao'an District, Shenzhen, China Mainland

♥ Hong Kong Office: Jianfa Street Industrial Zone, Tuen Mun, New Territories, Hong Kong, China

After-sales Service Address: Please contact our salesmen to obtain and provide the corresponding product maintenance reasons (Reference: 1.9. 095030-1843 Injector Valve Stem Nut Warranty Instructions)

4.2. Sale-men Contact Information

| No. | Name | WeChat/WhatsApp | Email | Facebook | YouTube | | | |
|--|--|-----------------|---------------------|-----------------|----------------|--|--|--|
| 1 | Ruby | +86-13410541523 | ruby@shumatt.com | Hison Li | Hison Li | | | |
| 2 | lvy | +86-18025309821 | sales@shumatt.com | Ivy Shumatt | Shumatt IVY | | | |
| 3 | Rebecca | +86-18025349821 | sales01@shumatt.com | Rebecca Shumatt | ShumattRebecca | | | |
| 4 | Janny | +86-18028749821 | sales02@shumatt.com | Janny shumatt | Janny Shumatt | | | |
| 5.11 | Sam | +86-13316859821 | Sales8@shumatt.com | Shumatt Sam | Sam Shumatt | | | |
| 6 | Natalie | +86-18938945856 | sales15@shumatt.com | Shumatt Natalie | Lin Natalie | | | |
| 7 | Ada | +86-1342286353 | sales5@shumatt.com | Shumatt Ada | Ada Shumatt | | | |
| 8 | Hison Li | +86-18318811871 | web@shumatt.com | Hison Li | Hison Li | | | |
| 9 | Mecca | +86-18938948618 | sales11@shumatt.com | Shumatt Mecca | Shumatt Mecca | | | |
| 10 | Eric | +86 18319033618 | sales3@shumatt.com | | | | | |
| 11 | Wayne (Joaquí n enespañol) | +86-13316959821 | wayne@shumatt.com | shumattwayne | Wayne Shumatt | | | |
| 12 | Sylvia | +86 18312499884 | sales6@shumatt.com | 31. 31. | 31. 31. | | | |
| Visit http://shumatt.com to obtain the latest information of salesmen | | | | | | | | |
| - ·mř | PS: Shumatt's sales-men's emails are all end with @shumatt.com | | | | | | | |

5. Copyright Statement

The copyright of any contents in this file "095030-1843 Injector Valve Stem G2 Series Technical File" (including but not limited to parameters, data, text, charts, images, sounds, videos, etc.) belongs to Shenzhen Shumatt Technology Co., Ltd. Without the prior written permission of Shenzhen Shumatt Technology Co., Ltd., you are not allowed to modify, duplicate, republish any content in "095030-1843 Injector Valve Stem G2 Series Technical File" in any way. At the same time, any conditions to spread, repost, display the contents of "095030-1843 Injector Valve Stem G2 Series Technical File" should indicate the

Mob/Whatsapp: +86 13410541523 Tel: +8675523215133

Email: ruby@shumatt.com Website: www.shumatt.com



source of the quoted article, Shenzhen Shumatt Technology Co., Ltd. Any actions failure to follow above conditions violate the "Copyright Law of the People's Republic of China" and other laws and regulations as well as relevant provisions of international conventions.

Mob/Whatsapp: +86 13410541523 Tel: +8675523215133

Email: ruby@shumatt.com Website: www.shumatt.com

© 2024 Shenzhen Shumatt Technology Co., Ltd

14 / 15